

#### English translation of abstract (CN 2054227U)

This utility model relates to rotary motor, and especially a synchronous generator with a low harmonic wave winding structure, wherein the stator windings embedded in the channels of the stator are concentric windings with different coils. In a polar phase group, the windings have different coils, but the total coils in the lower and upper layers in each channel may be equal so as to reduce or eliminate the harmful harmonic wave. As compared with the generator with pile windings, the present utility model save material of 8-18%, the efficiency of the generator is increased by 0.5-1%, the temperature rise is reduced by 8-18K, the manufacturing cost is reduced, the energy is saved and the life is prolonged.



## 四实用新型专利申请说明书

[21] 申请号 89205898.6

[51] IntCl

H02K 3/28

(43) 公告日 1990年3月7日

[22]申请日 89.8.11

[71]申请人 酒博电机二厂

地址 山东省獲博市张店区柳泉路 21 号邮码

255032

1721设计人 赵庆普

1741专利代理机构 福博市专利代理事务所 代理人 许光恒


H02K 19/16

说明书页意:

时间更强: 2

#### P4支用新型名称 任谐使发生同步发电机 P7.编码

本实用新型属于接转电机领域,涉及一种低谐放 使组结构的同步发电机,其特征在于嵌在定子槽中的定于键组为同心式不等匝绕组,在一个极相组内,各线圈不等匝,但在每槽内上下层总匝数可相等,以达到阴弱或消除有害谐波的目的。本实用新型与同规格采用量绕组结构的发电机相比较,节省原材料 8~18%,电机效率提高 0.5~1%,绕组组升降低 8~18K。降低生产成本,节省能源,延长使用寿命。

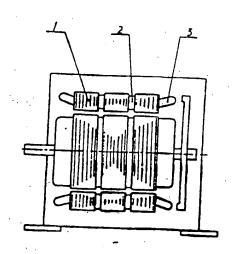

(BJ)第1452号

- 、低谱波绕组图步发电视包括定子、 转子。其特征在于最在定子槽中的定子绕组为同心式不等匝绕组,在一个根相组内。各线烟不等匝,包在每槽内上下层总匝数可相等。
- 、根据权利要求!所述的同步发电机其特征在于定子绕组结构 按特定匝数比分布可为以下几种不同的匝比。即6:4,3,1,5,4,2,1; 3,5,3,1。
  - 3、 根据权利要求 1、2 所述的同步发电机。其特征在于当跨距 1=1~11,在一个极相组内各线圈匝比为3,4,7,8,14,16。
  - 1、根据拟利要求1所述的同步发电机,其特征在于铁芯径向通风槽数比同规格叠绕组发电机减少1~2个。

17 , 1

# 1 1 p

#### 低谱波绕组网步发电机

本实用新型属于旋转电机领域,涉及一种低谐波绕组结构的同步发电机。

人们对于研究削弱和消除电机绕组有害谐波的绕组型式十分重视,并提出了较好的理论方案,如:一种通过公一Y两部分绕组串联或并联来消除谐波的正弦绕组。正弦绕组对于改善电机性能效果显著,但因中性点难以引出,而不宜用于同步发电机,目前,电机行业广泛采用的叠绕组结构同步发电机,不仅消耗大量的原材料,而且电机效率也较低。

为了避免上述不足之处,本实用新型提供一种生产工艺简单, 节约原材料,提高电机效率,降低绕组温升的低谐波绕组同步发电机。

为达到上述目的,结合附图对本实用新型的特征加以描述。

图! 低谐波绕组联接示意图(一个单元电机A相)。

图? 低谐波绕组同步发电机结构示意图。

图中: 1定子铁芯, 2径向通风槽、3低谱波定子绕组。

如图? 所示。低谐波绕组同步发电机的特征在子敬在定子槽中的定子绕组为特定匝数比分布的同心式不等匝绕组,即合理搭配处于对称轴线附近各槽的匝数,从而最大限度地减少磁势中有害谐波的含量和削弱磁势谐波的幅值,在一个极相组内,各线圈不等匝,按特定要求分布,但在每槽内上下层总匝数相等。

所谓接特定要求分布,是当定子绕组上下层匝最按以下几种不同的匝比布置时,将可取得大幅度削减以致消除有害谐波的效果。

1、定子绕组上下层分布规律如图1所示。当在一个极相组内各线圈匝比为a,b,c,d=6.678114,4.663901,2.931851,1时,其5、7、i, 13、17、19、29、31……次谐波均消除,实际匝比近似整数值可为b,4,3;1或5,4,2;1。

2、当在一个极相组内各线圈匝比以8. E. C. d = 0.5, 0.8164966.
0.5773503.0.2988585时,其5、7、11、13、17、19、29、31次谐波均消除。实际匝比确定可取近似整数值3.5.3.1。线圈跨距:1—13 8匝,2—12 b匝,3—11 c匝,4—10 d匝。

3、 当跨距y=1~11, 在一个极相组内各线圈匝比为a:a,b:b=0.866025,0.866025;1:1时,其5、7、17、19次谐波消除。 实际匝比可取近似整数值为a:b=3:4、7,8、14:16.....。

本实用新型的优点,由于有害谐波大幅度削弱或消除,改善了磁势波形,降低杂散损耗,提高电机效率,降低绕组温升,减小电压波形畸变率。本实用新型比同规格叠绕组发电机的定子、转子铁芯长度缩短,径向通风槽数减少1-2个,节约原材料。

实施例:

1、『FX355Ⅱ—6 160K』同步发电机,采用低谐波绕组结构,每极相组中的匝数分布为,跨距1—12 6匝,2—11 4匝,3—10 3匝,4—9 1匝,每槽7匝。在定子、转子铁芯缩短40±1情况下,主要性能指标符合标准要求,效率、振动仍优于叠绕组电机,其性能指

\	效率	稳力	杂集	电压	炭加	噪声	最动	癸组
<b>数1 胎</b>		电压	办电	效形	炭減	48 (4)	11/5	温升
御參	101	调整	压变	畸变	电压			(1)
制物	•	串	他率	串	变化			
A)		193	191	(2)	*			
					(4)			
禄准值	91.5	±H	±5	5	-15	101	4.5	80
DB/3700E					1.		<b>)</b> • •	
21011-89					+20			
低谐波电机	98.04	1.5	2	0.54	-9,6	9.0	1.1	<b>9</b> 8
					. /			(定子
				·	+8.2			/49
		l				I		【转子

2、「FI355112-6 20011日步发电机,采用双层同心式不等匝绕组,跨距1-12 5匝, 2-11 4匝, 1-10 2匝, 4-9 1匝, 每槽6匝, 其铁芯长度比叠绕组电机缩短75mm, 减少了两进径向通风槽。

技术经济效果: 低谐波蜿组阿步发电机与叠绕组电机相比较, 效果墨著。


例: [68] 低谱波绕组同步发电机,每台节省硅铜片96.25公斤, 唿磁铜线1.85公斤,薄钢板46.27公斤,铜阻尼条8.88公斤, 绝缘 材料4.9公斤,年节电43981116。

采用低谐波绕组能使电机节省有效原材料8-18%, 电机效率提高8.5~1%, 绕组温升降低8~18%。

图

U

7

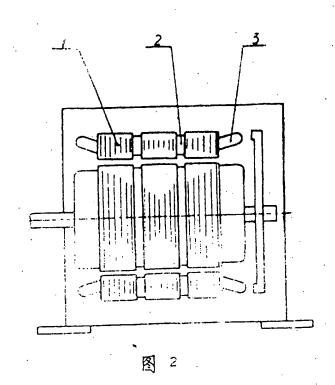

ັ8

# This Page is Inserted by IFW Indexing and Scanning Operations and is not part of the Official Record

### BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

BLACK BORDERS

IMAGE CUT OFF AT TOP, BOTTOM OR SIDES

FADED TEXT OR DRAWING

BLURRED OR ILLEGIBLE TEXT OR DRAWING

SKEWED/SLANTED IMAGES

COLOR OR BLACK AND WHITE PHOTOGRAPHS

GRAY SCALE DOCUMENTS

LINES OR MARKS ON ORIGINAL DOCUMENT

REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY

IMAGES ARE BEST AVAILABLE COPY.

☐ OTHER: \_\_\_\_

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.